

IMPORTANT PRODUCT INFORMATION

READ THIS INFORMATION FIRST

Products:	6" QuickPanel* Control	IC754CSL06CTD-HF	IC754CBL06CTD-HF
		IC754CGL06CTD-DD	IC754CHL06CTD-DD
	6" QuickPanel View	IC754VSL06CTD-HF	IC754VBL06CTD-HF
		IC754VGL06CTD-DD	IC754VHL06CTD-DD

Note: This document contains information that is not available in any other publication; therefore, we recommend you save it for future reference. Read this document before installing or attempting to use the products listed above.

The QuickPanel Control and QuickPanel View products listed above have been changed to incorporate a new version of the Windows CE.NET operating system. Full details below.

Update Strategy

The software changes are not field installable. Users experiencing the problems listed below should contact Customer Care.

Replaces

IC754CSL06CTD-HE, IC754CBL06CTD-HE, IC754CGL06CTD-DC, IC754CHL06CTD-DC, IC754VSL06CTD-HE, IC754VBL06CTD-HE, IC754VGL06CTD-DC, IC754VHL06CTD-DC

Documentation

Hardware User's Guide, CGL, VGL, CHL, and VHL models: GFK-2305 or later

Hardware User's Guide, all others: GFK-2243D or later

The most recent QuickPanel documentation is available on the Support website:

<http://www.ge-ip.com/support>

Functional Compatibility

Projects for the existing Windows CE based QuickPanel View or QuickPanel Control models are compatible with the new models and Machine Edition software (see Operational Notes below).

Problems Resolved by this Revision

The listed models include a new version of the Windows CE.NET operating system, v1.03.0045, which incorporates a number of corrections.

- Includes all Microsoft QFE (Quick Fix Engineering) patches prior April 20, 2004.
- The RestorePCCard utility has been changed to correct an inability to restore projects backed up to Compact Flash (CF) card from previous versions of the product. This correction allows both upward and backwards compatibility for restores from CF card.
In addition, RestorePCCard now correctly restores all files needed for OPC driver and VBScript operation.
- The system Storage Manager has been updated to disable certain buttons on the Storage Manager dialog when no stores or partitions are available.
- Corrected key mapping for Large Key SIP on shifted comma, period, and forward slash.

* indicates a trademark of GE Intelligent Platforms, Inc. and/or its affiliates. All other trademarks are the property of their respective owners. All rights reserved.

Operational Notes

The QuickPanel View and Control products listed above require Machine Edition v4.0, Service Pack 2 (or later) for configuration.

Installation in Hazardous Areas

WARNING – EXPLOSION HAZARD – SUBSTITUTION OF COMPONENTS MAY IMPAIR SUITABILITY FOR CLASS I, DIV. 2 OR ZONE 2 AREAS

WARNING – EXPLOSION HAZARD – WHEN IN HAZARDOUS AREAS, TURN OFF POWER BEFORE REPLACING OR WIRING MODULES

WARNING – EXPLOSION HAZARD – DO NOT DISCONNECT EQUIPMENT UNLESS POWER HAS BEEN SWITCHED OFF OR THE AREA IS KNOWN TO BE NONHAZARDOUS.

Power, Input and Output (I/O) wiring must be in accordance with Class I, Div. 2 wiring methods, Article 501 10(b) of the National Electrical Code, NFPA 70 or in accordance with the authority having jurisdiction.